
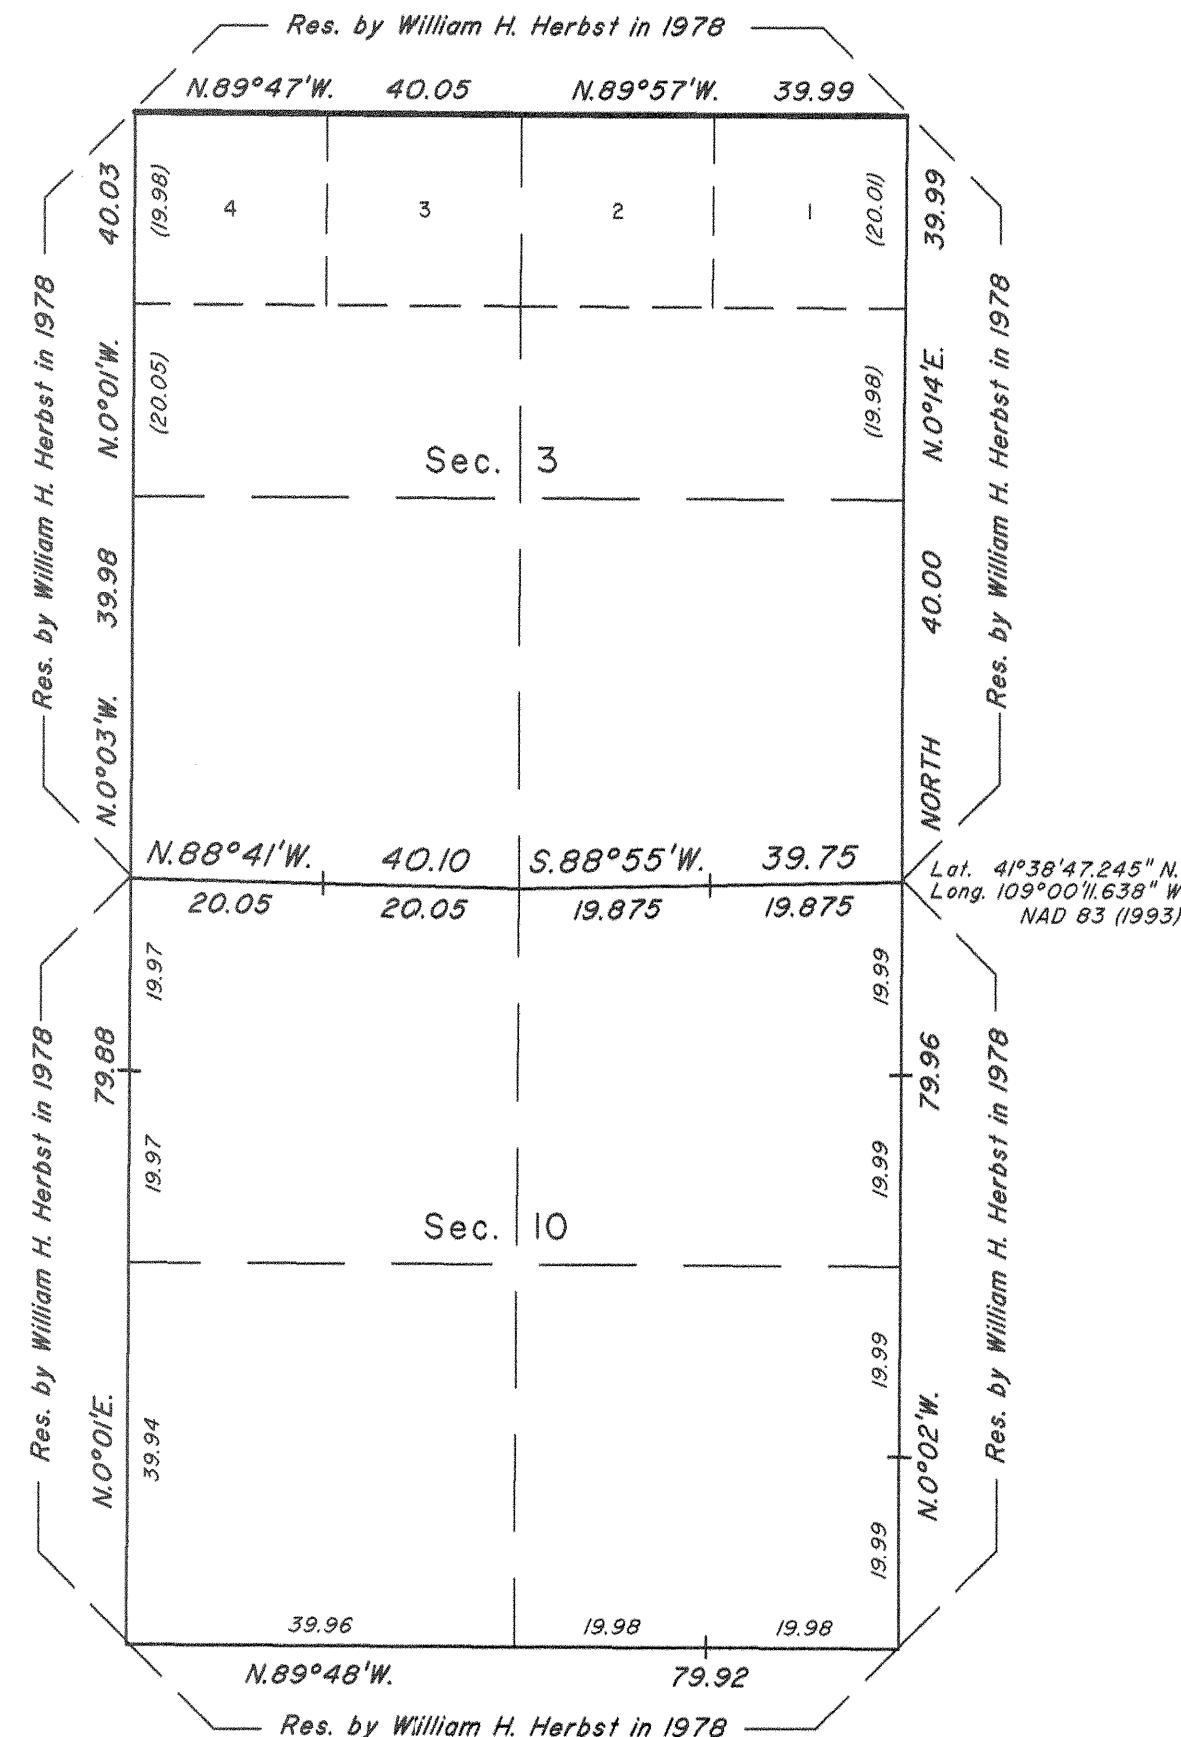


TOWNSHIP 19 NORTH, RANGE 103 WEST, OF THE SIXTH PRINCIPAL MERIDIAN, WYOMING.
CORRECTIVE DEPENDENT RESURVEY

Sheet 1 of 2

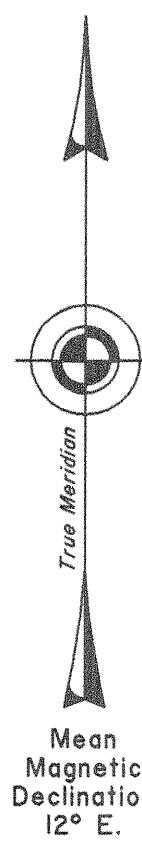

SURVEY INFORMATION AND CERTIFICATE

These plats represents the entire record of the corrective dependent resurvey of a portion of the subdivisional lines designed to restore the corners in their true original locations according to the best available evidence, Township 19 North, Range 103 West, Sixth Principal Meridian, Wyoming.

Richard Blackstone surveyed the north, east and south boundaries in 1876 and the subdivisional lines in 1877. George M.P. Dougall and Newill J. Burnham resurveyed the exterior boundaries and subdivisional lines in 1906. William H. Herbst resurveyed the exterior boundaries and subdivisional lines in 1978.

In a letter to the Chief Cadastral Surveyor, Wyoming, dated March 4, 2004, Craig A. Shauers, Wyoming Registered Land Surveyor No. 2929, detailed evidence that led him to believe that the 1978 dependent resurvey had overlooked collateral evidence and improperly restored the 1/4 section cor. of secs. 3 and 10. A subsequent field investigation confirmed Shauers' findings. The field investigation is documented in a memorandum to the Chief Cadastral Surveyor, Wyoming, dated October 26, 2004. This memorandum is included in the official file for Group 739, Wyoming. The corrective dependent resurvey shown hereon corrects the 1978 dependent resurvey.

Lottings and areas are as shown on the plat approved January 14, 1908 and the supplemental plat accepted August 21, 1956.


The survey was executed with Trimble Navigation Model 4700 Global Positioning System (GPS) receivers. The GPS procedures used were in accordance with IM No. 2001-186, "Standards and Guidelines for Cadastral Surveys Using Global Positioning System Methods", dated July 26, 2001. The directions of all lines refer to the true meridian. The directions, distances, and geographic positions were determined by GPS observations.

I, Olian T. Shockley, HEREBY CERTIFY upon honor, that in pursuance of special instructions bearing the date of October 20, 2004, and Assignment Instructions dated October 20, 2004, for Group Number 739, Wyoming, I have corrected the dependent resurvey of a portion of the subdivisional lines, Township 19 North, Range 103 West, Sixth Principal Meridian, Wyoming, and that these plats represents the entire record of this survey. Survey commenced November 1, 2004, and completed April 20, 2005, and has been made in strict conformity with the special instructions, the Manual of Surveying Instructions for the Survey of Public Lands of the United States, 1973, and the manner described hereon.

*Olian T. Shockley*Olian T. Shockley
Cadastral Surveyor

June 2, 2005

Date

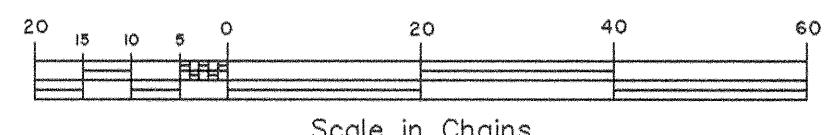

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Cheyenne, Wyoming

June 2, 2005

This plat representing the entire record of this survey, having been correctly executed in accordance with the requirements of law and the regulations of this bureau, is hereby accepted.

For the Director

John P. Lee

John P. Lee
Chief Cadastral Surveyor for Wyoming

TOWNSHIP 19 NORTH, RANGE 103 WEST, OF THE SIXTH PRINCIPAL MERIDIAN, WYOMING.
CORRECTIVE DEPENDENT RESURVEY

Sheet 2 of 2

The cor. of secs. 2, 3, 10 and 11, monumented with an iron post, $2\frac{1}{2}$ ins. diam., firmly set, witnessed by an iron rod, 1 in. diam., projecting 24 ins. above ground alongside the cor., with a steel fence post nearby, with brass cap mkd.

TI9N R103W
S 3 | S 2
—
S 10 | S 11
1978

Cor. is located on open barren ground.

Point for the E 1/16 sec. cor. of secs. 3 and 10.

Set a Berntsen Feno® monument, a chrome plated steel rod, $\frac{1}{8}$ in. diam., 24 ins. long, 23 ins. in the ground, with aluminum cap mkd.

BLM
TI9N R103W
S 3
—
E 1/16
S 10
2004
CADASTRAL SURVEY

Set a steel fence post nearby.

Cor. is located in an abandoned asphalt roadway, 4 lks. S. of a line of abandoned cars, bears E. and W.

Note: No evidence remains of the erroneous position of the E 1/16 sec. cor. of secs. 3 and 10, monumented during the 1978 dependent resurvey. This position falls in a track road in the Wyoming Auto Junkies, Inc. automobile salvage yard.

The 1/4 sec. cor. of secs. 3 and 10, determined at a burned and fragmented fence cor. (wooden), indefinable diam., 14 ins. below the surface of the ground. Abandoned fence posts extend N. and E., an abandoned 4 strand barbed wire fence extends S. This is accepted as the best available evidence of the position of the original cor.

At the corner point

Set a stainless steel post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 25 ins. in the ground, over a plastic coated magnet, with brass cap mkd.

TI9N R103W
S 3
—
1/4
S 10
2004

Raise a mound of stone, 2 ft. base, 1 ft. high, N.; and set a steel fence post nearby.

From this point, the erroneous position of the 1/4 sec. cor. of secs. 3 and 10, reestablished during the 1978 dependent resurvey, bears N. $11^{\circ} 52'$ W., 85.3 lks. dist.; monumented with an iron post, $2\frac{1}{2}$ ins. diam., 28 ins. long, firmly set, flush with the surface of the ground, with brass cap mkd. TI9N R103W S3 1/4 S10 1978. Add the mks. AM 2004 on the brass cap and bury the iron post in place 7 ins. below the surface of the ground, over a plastic coated magnet, and set a steel fence post nearby.

From this same point, the original 1/4 sec. cor. of secs. 3 and 10, a sandstone, $18 \times 11 \times 3$ ins., lying disturbed atop the ground, plainly mkd. 1/4 on one face, bears S. $19^{\circ} 26'$ W., 31.6 lks. dist. Remove this stone from the vicinity.

Point for the W 1/16 sec. cor. of secs. 3 and 10.

Set a stainless steel post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 21 ins. in the ground, over a plastic coated magnet, with brass cap mkd.

TI9N R103W
S 3
—
W 1/16
S 10
2004

Set a steel fence post nearby.

Cor. is located 4 lks. N. of the southern right-of-way fence of U.S. Interstate Highway I-80, bears ENE. and WSW.

From this point, a broken cement post, 5 ins. square, firmly set, projecting 5 ins. above ground, bears N. $3^{\circ} 07'$ E., 42.3 lks. dist. No brass tablet was found.

From this same point, the erroneous position of the W 1/16 sec. cor. of secs. 3 and 10, established during the 1978 dependent resurvey, bears N. $12^{\circ} 47'$ W., 42.4 lks. dist.; monumented with a bent iron post, $2\frac{1}{2}$ ins. diam., 28 ins. long, firmly set, projecting 6 ins. above ground, with brass cap. Add the mks. AM on the iron post, cut in half and then bury in place, 6 ins. below the surface of the ground, over a plastic coated magnet and set a steel fence post nearby.

From this same point, a brass tablet, set in the top of a cement post, 6 ins. square, firmly set, projecting 4 ins. above ground, mkd. STATE HIGHWAY DEPT. SEC LINE 1500+80 sta El 6372.53 -R.O.W. MARKER-, bears S. $61^{\circ} 16'$ W., 22.86 chs. dist.

The cor. of secs. 3, 4, 9 and 10, monumented with an iron post, $2\frac{1}{2}$ ins., firmly set, with a steel fence post nearby, with brass cap mkd.

TI9N R103W
S 4 | S 3
—
S 9 | S 10
1978

Cor. is located on open barren ground.

The coordinates are listed for location purposes only; not for determination of the position of the corner.

(Coordinates are NAD 83 1993)

Corner: cor. of secs. 2, 3, 10 and 11
Latitude: $41^{\circ} 38' 47.245''$ N.
Longitude: $109^{\circ} 00' 11.638''$ W.

Corner: E 1/16 sec. cor. of secs. 3 and 10
Latitude: $41^{\circ} 38' 47.001''$ N.
Longitude: $109^{\circ} 00' 28.909''$ W.

Corner: W 1/16 sec. cor. of secs. 3 and 10
Latitude: $41^{\circ} 38' 46.756''$ N.
Longitude: $109^{\circ} 00' 46.180''$ W.

Corner: W 1/16 sec. cor. of secs. 3 and 10
Latitude: $41^{\circ} 38' 47.058''$ N.
Longitude: $109^{\circ} 01' 03.601''$ W.

Corner: cor. of secs. 3, 4, 9 and 10
Latitude: $41^{\circ} 38' 47.360''$ N.
Longitude: $109^{\circ} 01' 21.023''$ W.

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Cheyenne, Wyoming

June 2, 2005

This plat representing the entire record of this survey, having been correctly executed in accordance with the requirements of law and the regulations of this bureau, is hereby accepted.

For the Director


John P. Lee
Chief Cadastral Surveyor for Wyoming



ORIGINAL

7586 - 448C

TOWNSHIP 19 NORTH, RANGE 103 WEST, OF THE SIXTH PRINCIPAL MERIDIAN, WYOMING.
DEPENDENT RESURVEY

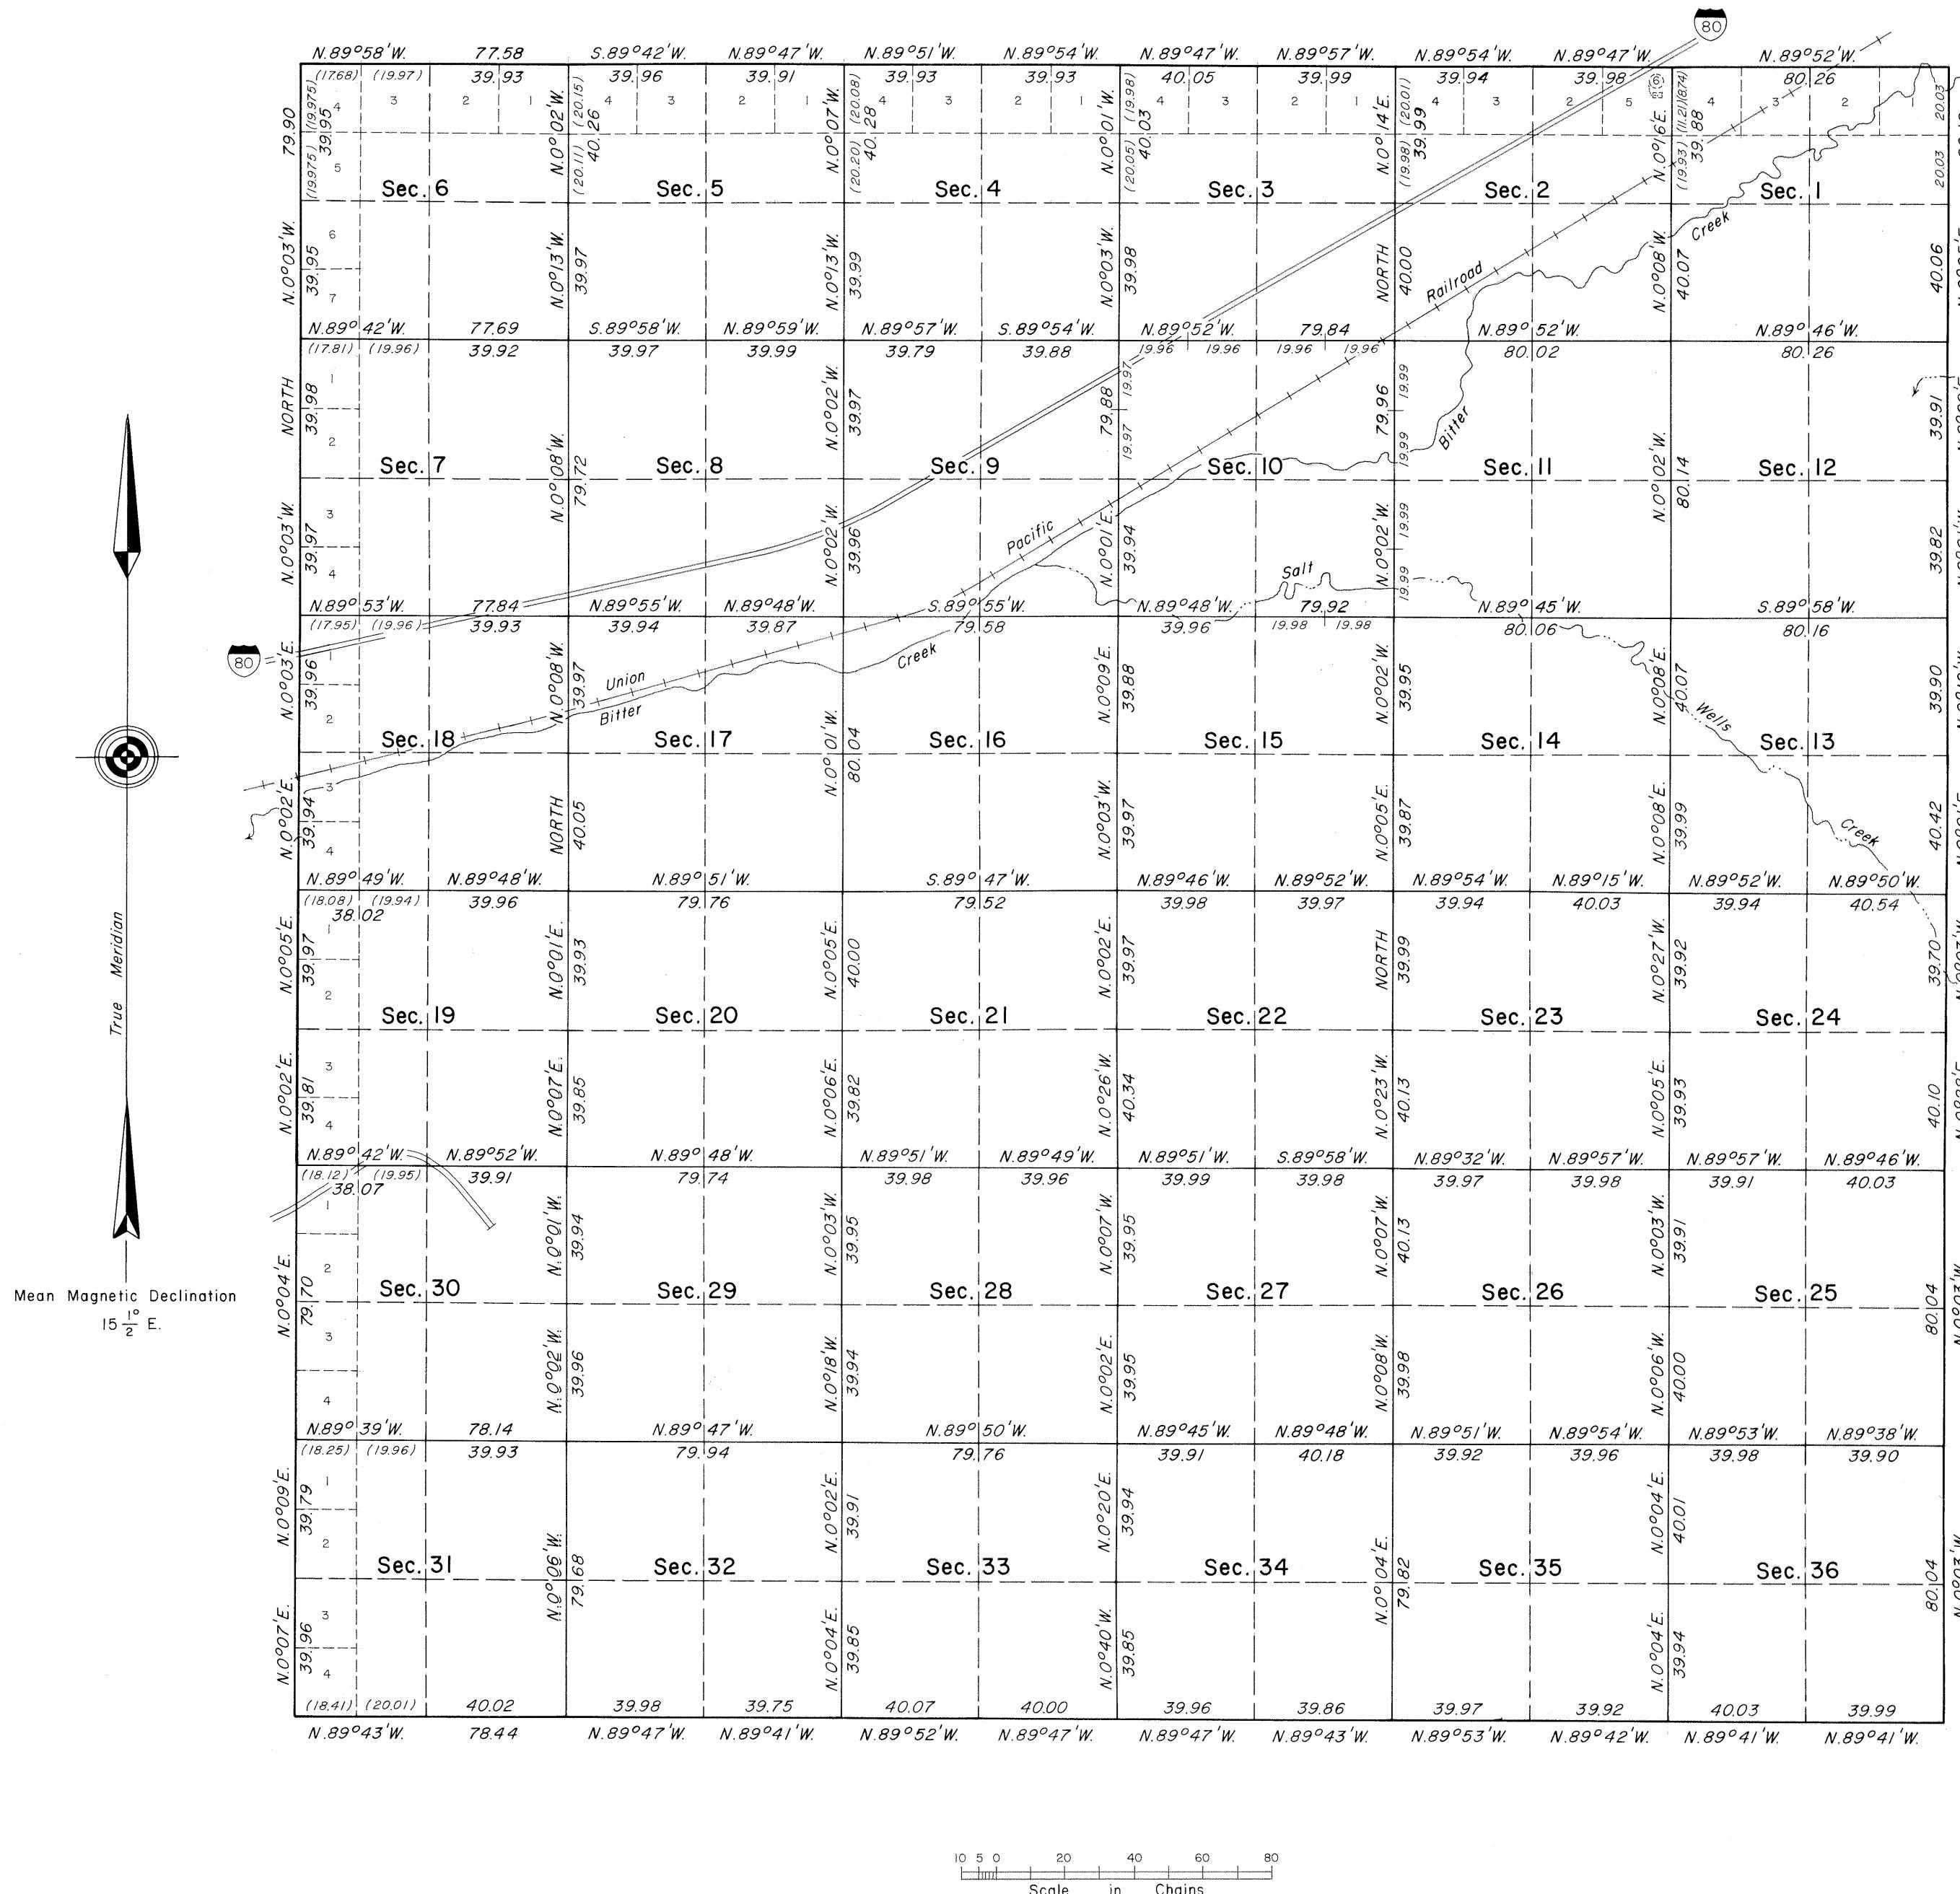

A history of surveys is contained in the field notes.

This plat represents the dependent resurvey of the exterior boundaries and the subdivisional lines designed to restore the corners in their true original locations according to the best available evidence, T. 19 N., R. 103 W., Sixth Principal Meridian, Wyoming.

The lottings and areas are as shown on the plat approved January 14, 1908 and the supplemental plat accepted August 21, 1956.

Survey executed by William H. Herbst, Supervisory Cadastral Surveyor, beginning May 8, 1978 and completed June 23, 1978, pursuant to Special Instructions dated April 21, 1978, for Group No. 401, Wyoming.

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Denver, Colorado January 18, 1982


This plat is strictly conformable to the approved field notes, and the survey, having been correctly executed in accordance with the requirements of law and the regulations of this Bureau, is hereby accepted.

For the Director

Mary J. Spiegel

Acting Chief, Cadastral Survey
Examination and Approval Staff

TOWNSHIP 19 NORTH, RANGE 103 WEST OF THE SIXTH PRINCIPAL MERIDIAN, WYOMING.
SUPPLEMENTAL PLAT

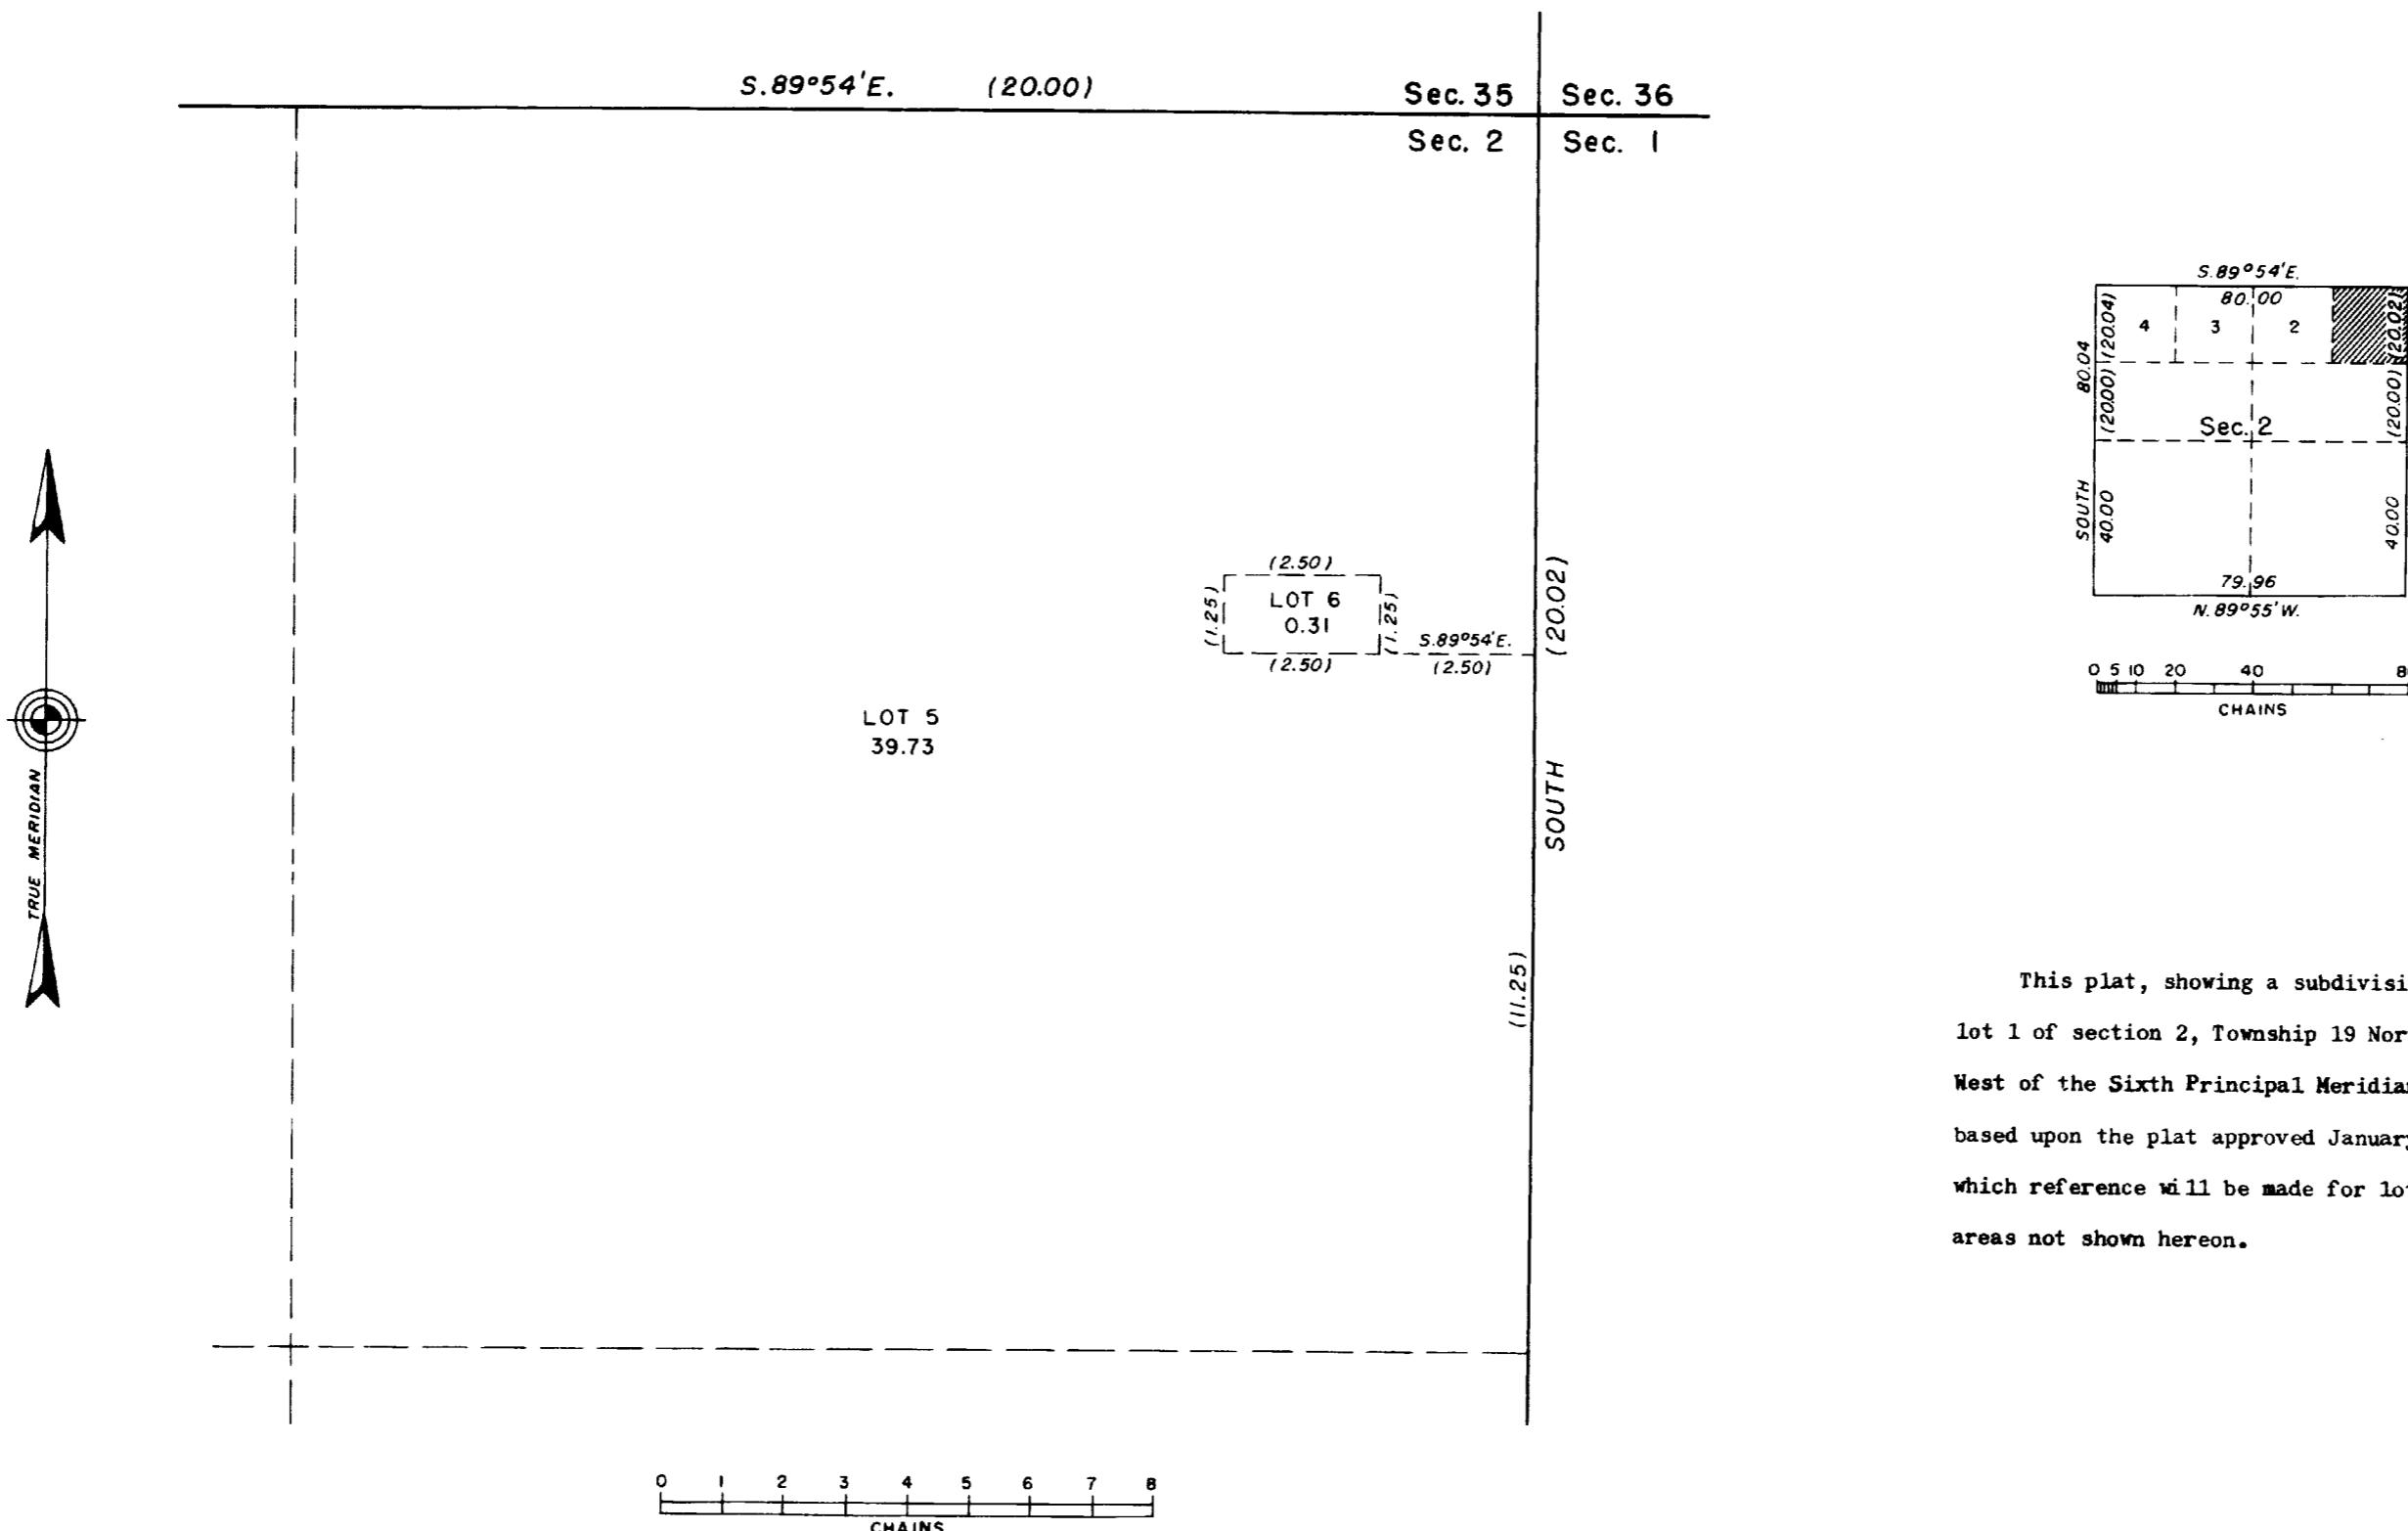

This plat, showing a subdivision of original lot 1 of section 2, Township 19 North, Range 103 West of the Sixth Principal Meridian, Wyoming, is based upon the plat approved January 14, 1908, to which reference will be made for lottings and areas not shown hereon.

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Washington, D. C. August 21, 1956

This plat showing amended lottings, having been correctly prepared in accordance with the regulations, is hereby accepted.


For the Director

Earl G. Harrington
Cadastral Engineering Staff Officer


(4-6759)

530

Resurvey Township N^o19 North, Range N^o103 West of the Sixth Principal Meridian, Wyoming.

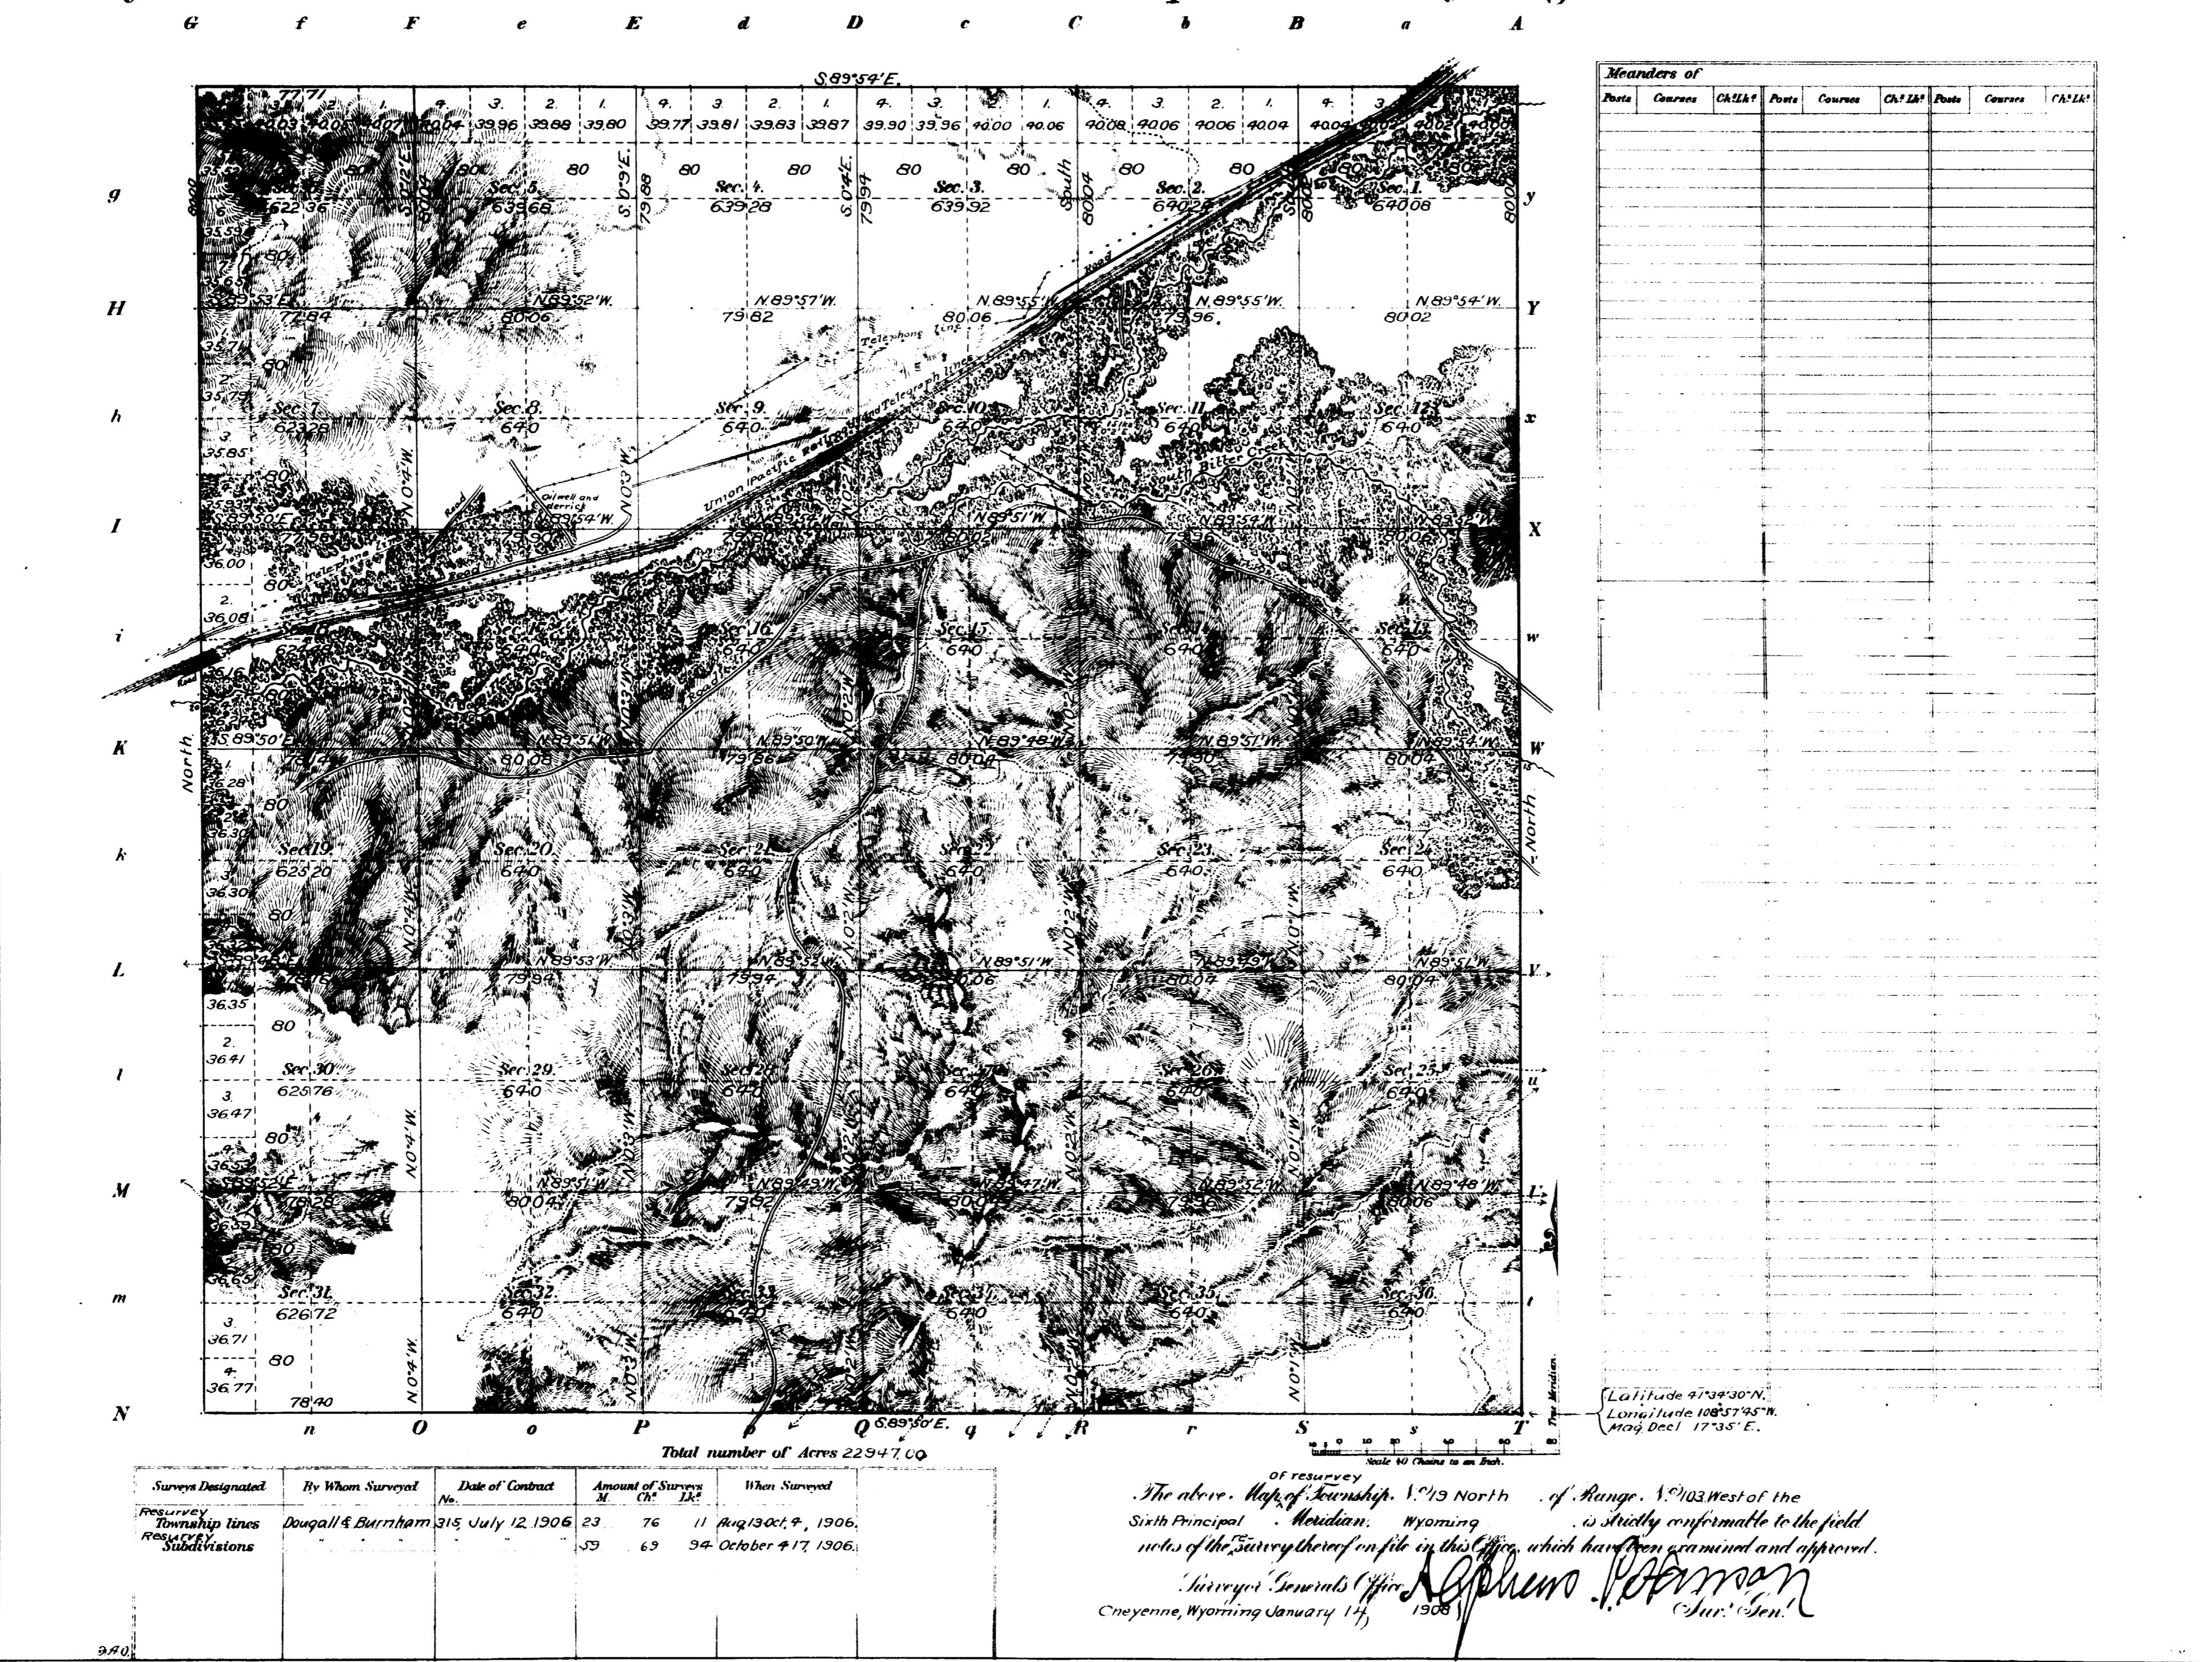


Accepted by the Non-Commissioner in his letter "E" August 21, 1908. Duplicate plat forwarded to Evanston Land Office, August 25, 1908.

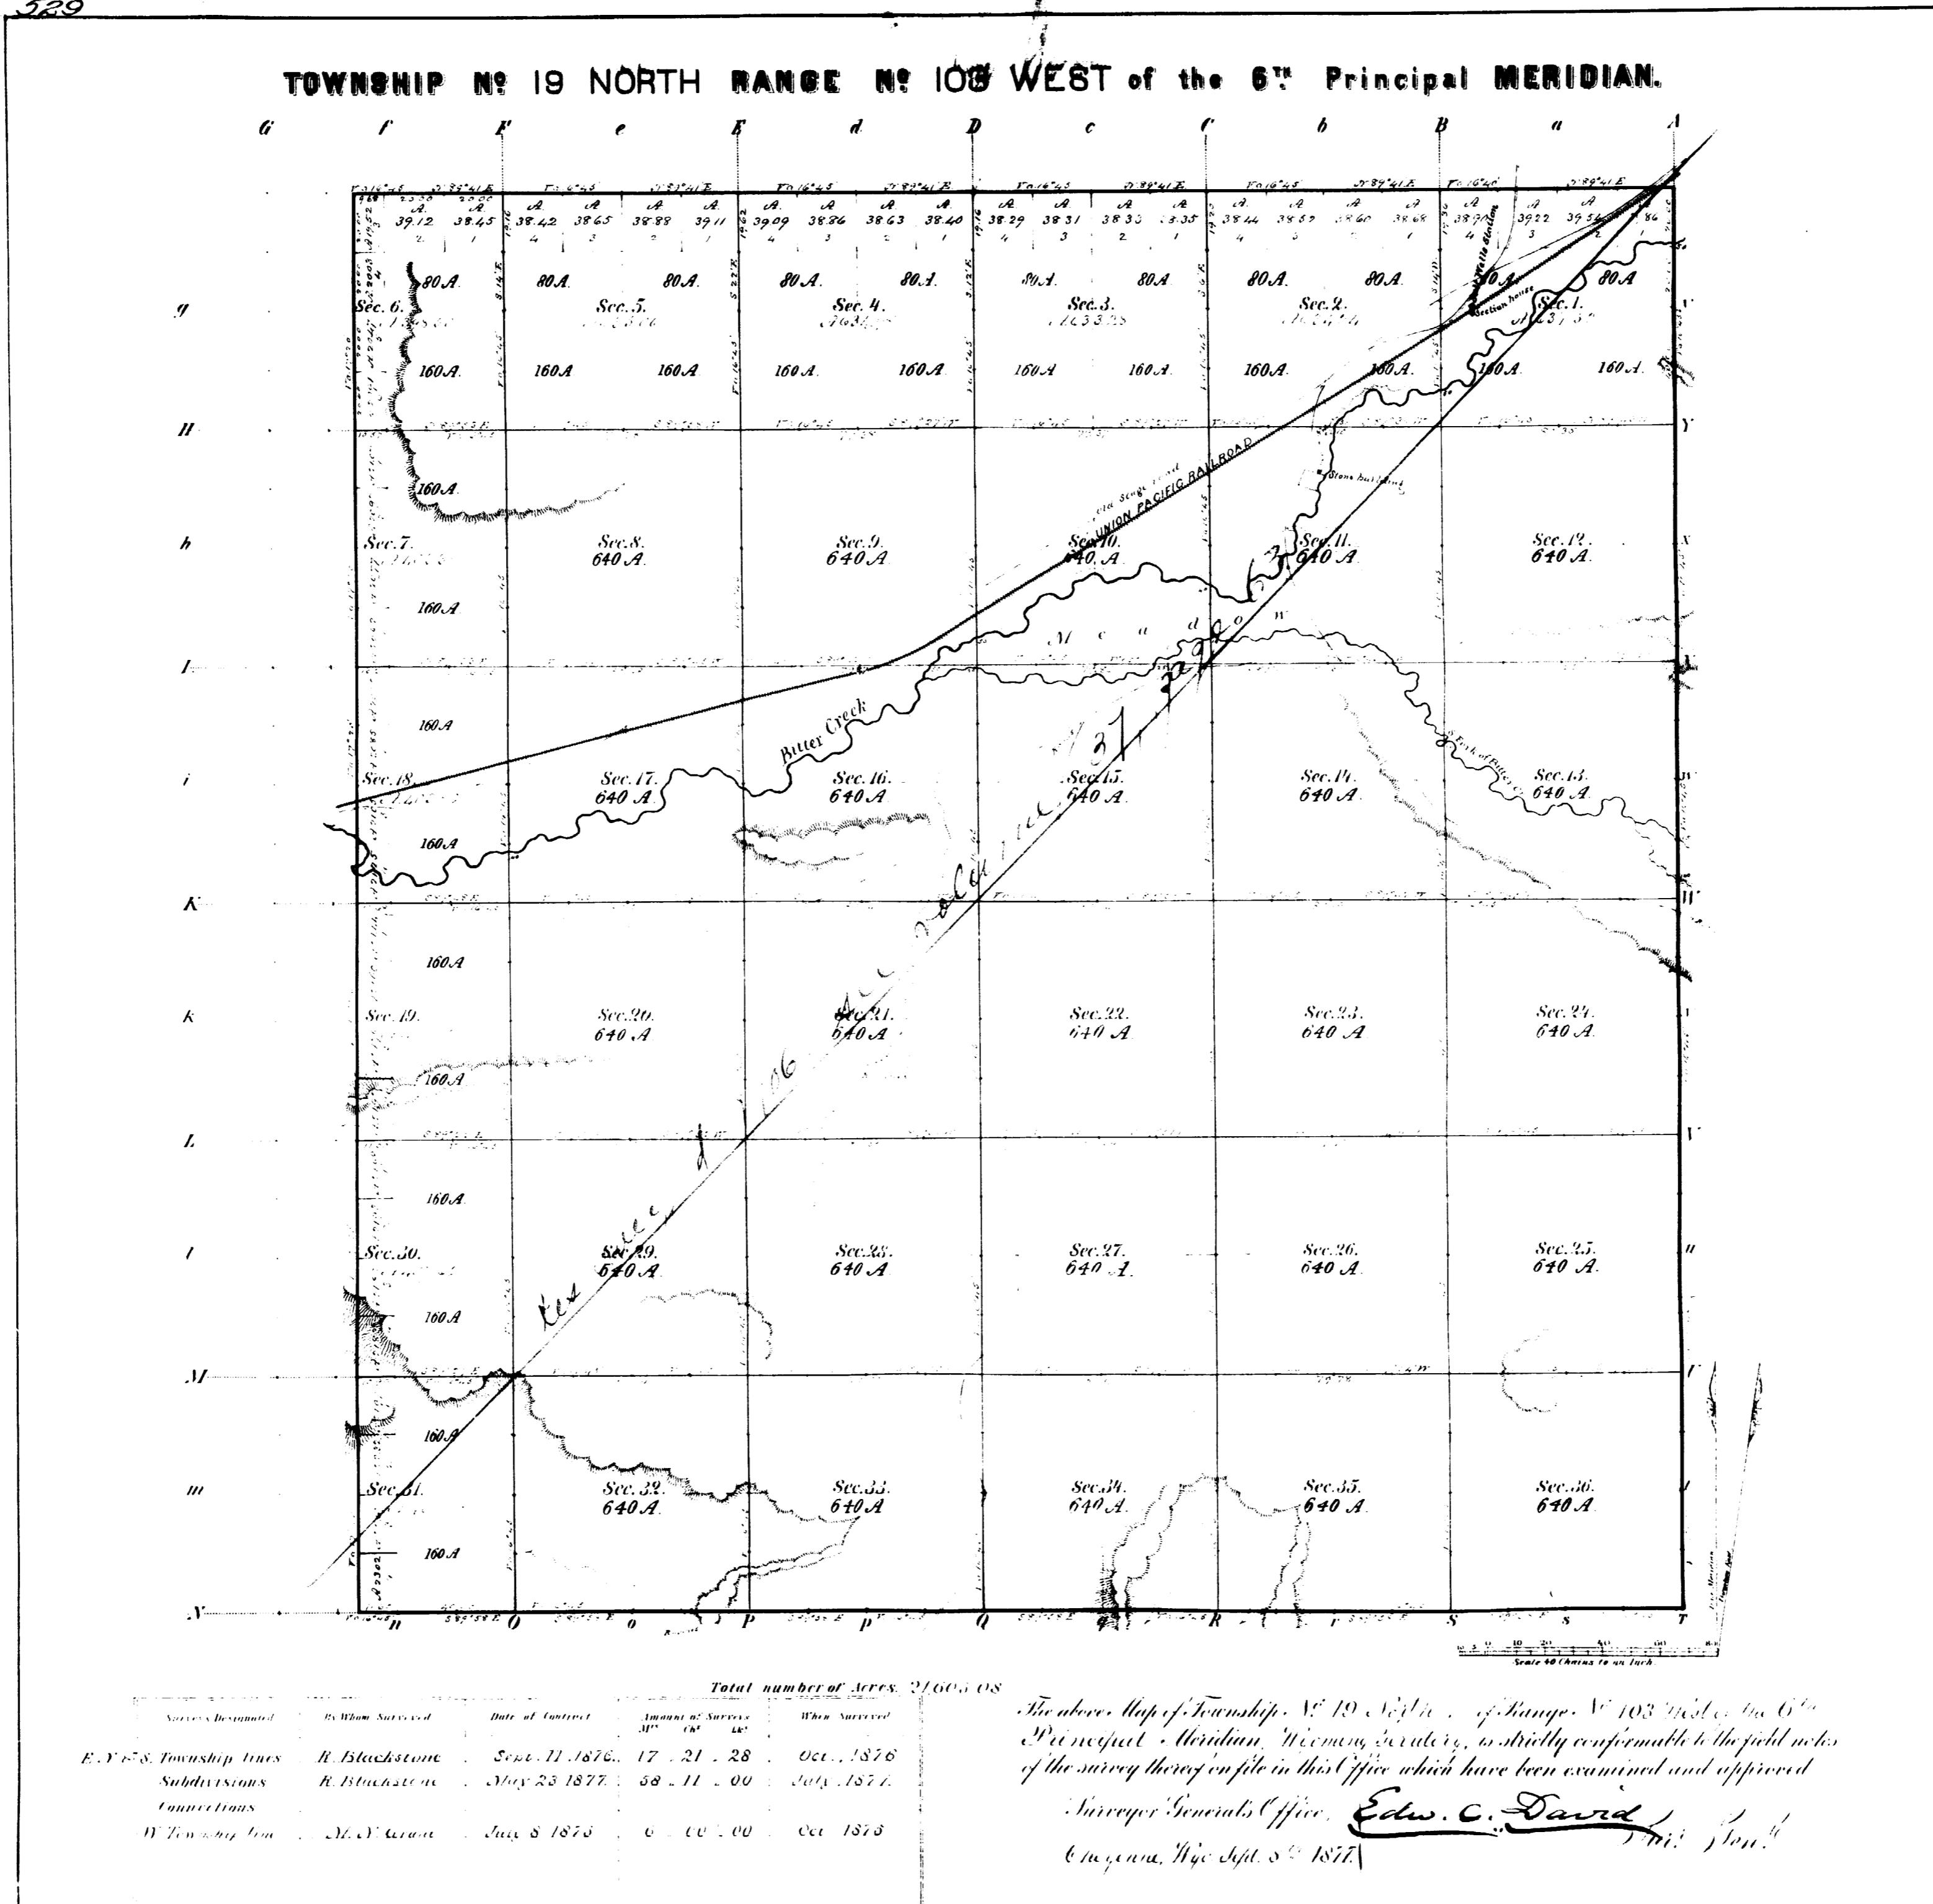

37
Index

4856

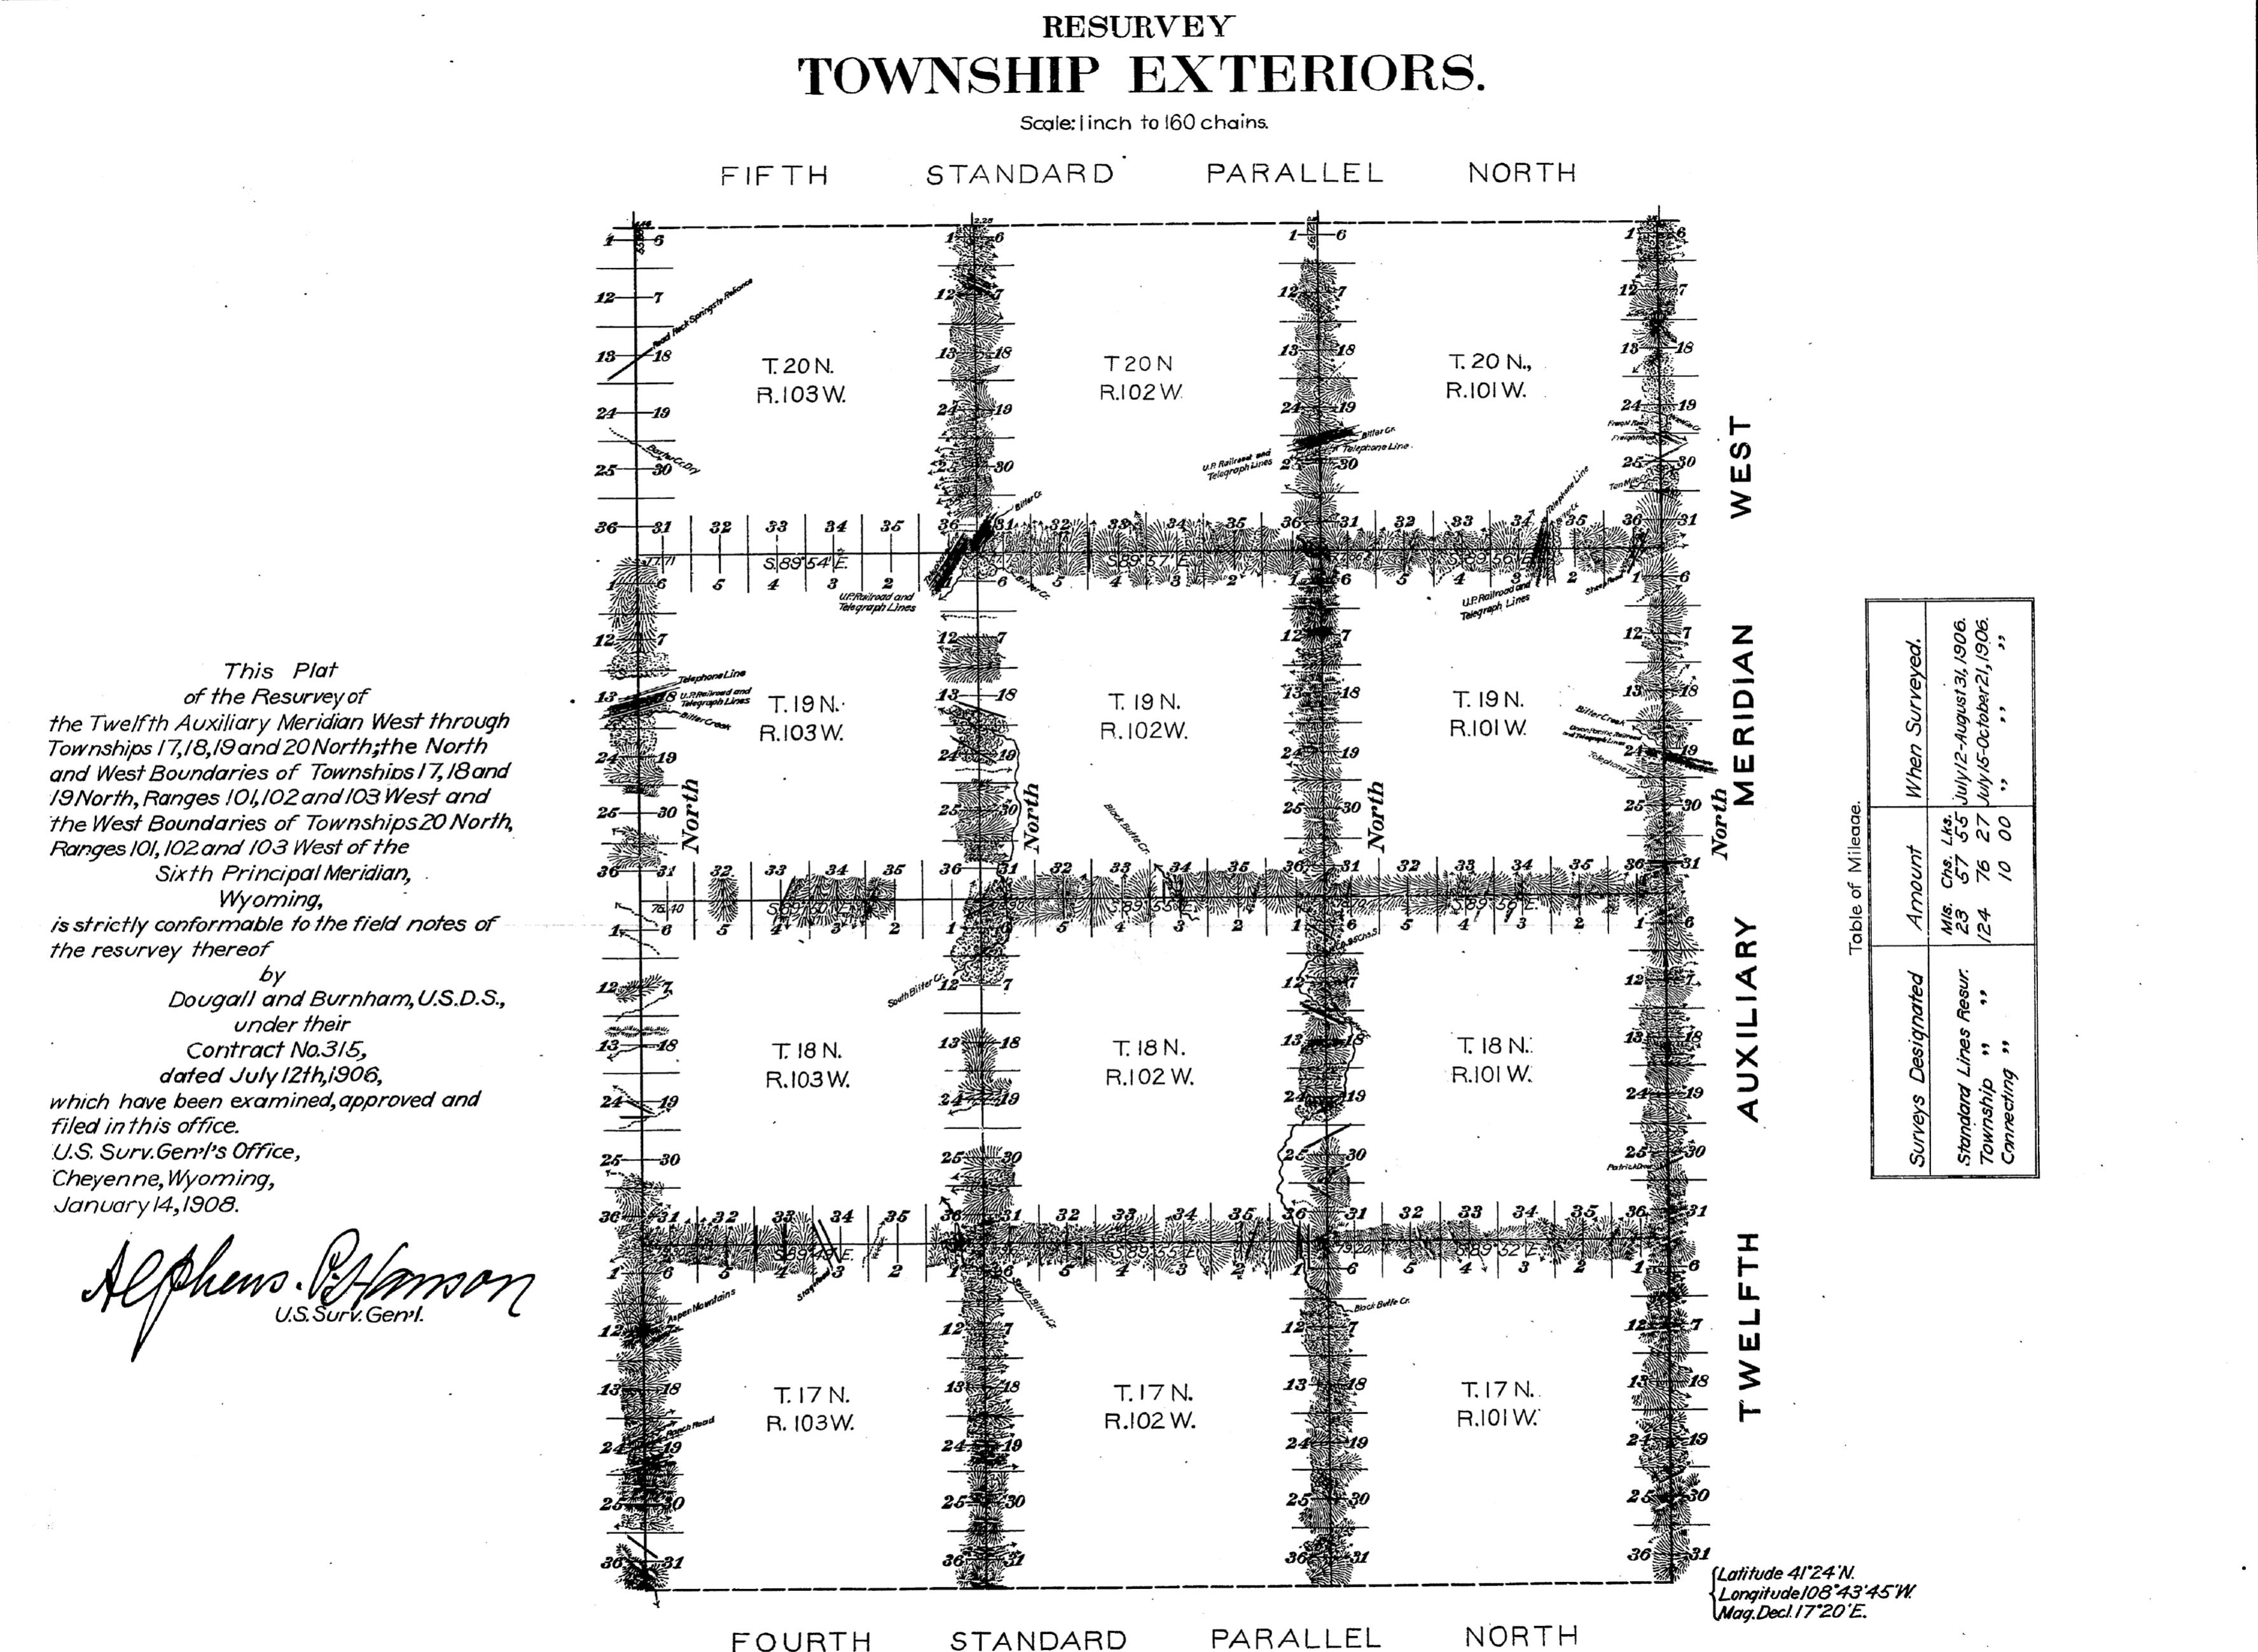

2908

A.M.T.

R

Accepted by the Hon. Commissioners in his letter
"E," August 21, 1908.


52

grdles

509

Compared.

EXTERIOR LINES

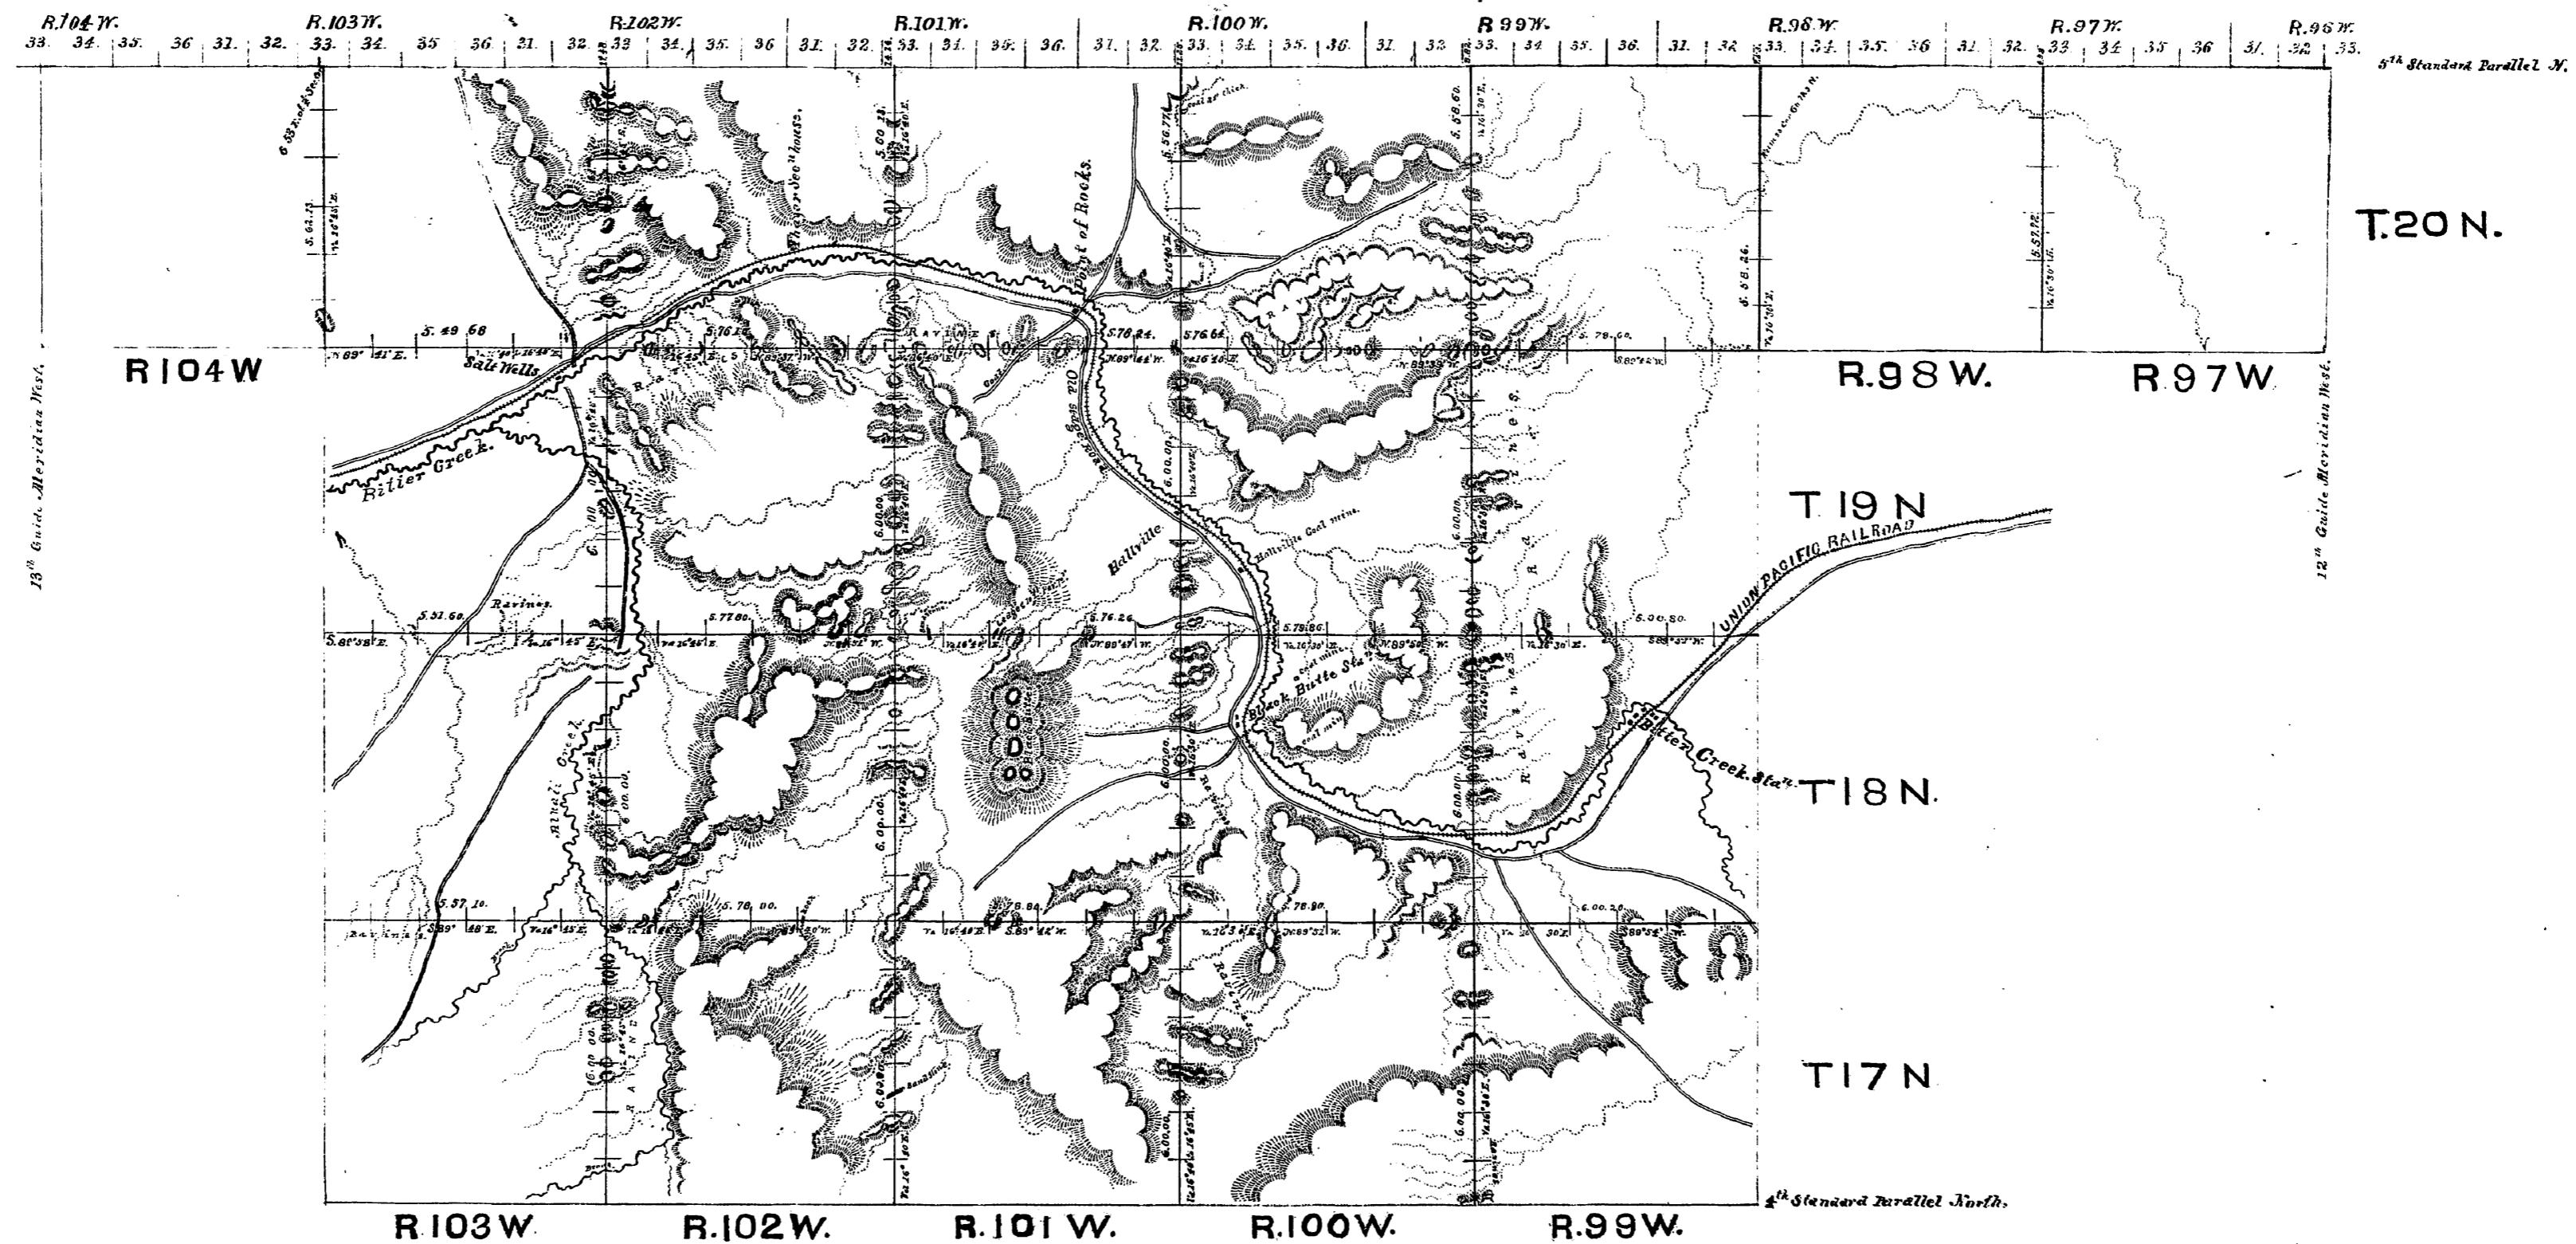

Surveys designated	By whom surveyed	Date of Contract	Amount of Surveys	When Surveyed
Township Exteriors	Richard Blackstone	September 1 st 1870	200 73 95	Sept 4- Oct 1870
Connections	" "	" "	" "	11 - 68

Surveyor General's Office,
Cheyenne, Wyoming, 28. 1872.

I hereby certify that the above diagram of the exterior lines of Township 20
North, Ranges 97 and 98 West, Townships 17, 18, 19 and 20, North, Ranges 99, 100 and 101, and
103 West, and Township 20 North, Range 200 West of the 6th Principal Meridian in Wyoming Terri-
tory, is strictly conformable to the field notes of the Survey thereof on file in this
Office, which have been examined and approved.

Edw. C. David
Surveyor General.