


TOWNSHIP 19 NORTH, RANGE 103 WEST, OF THE SIXTH PRINCIPAL MERIDIAN, WYOMING.

CORRECTIVE DEPENDENT RESURVEY

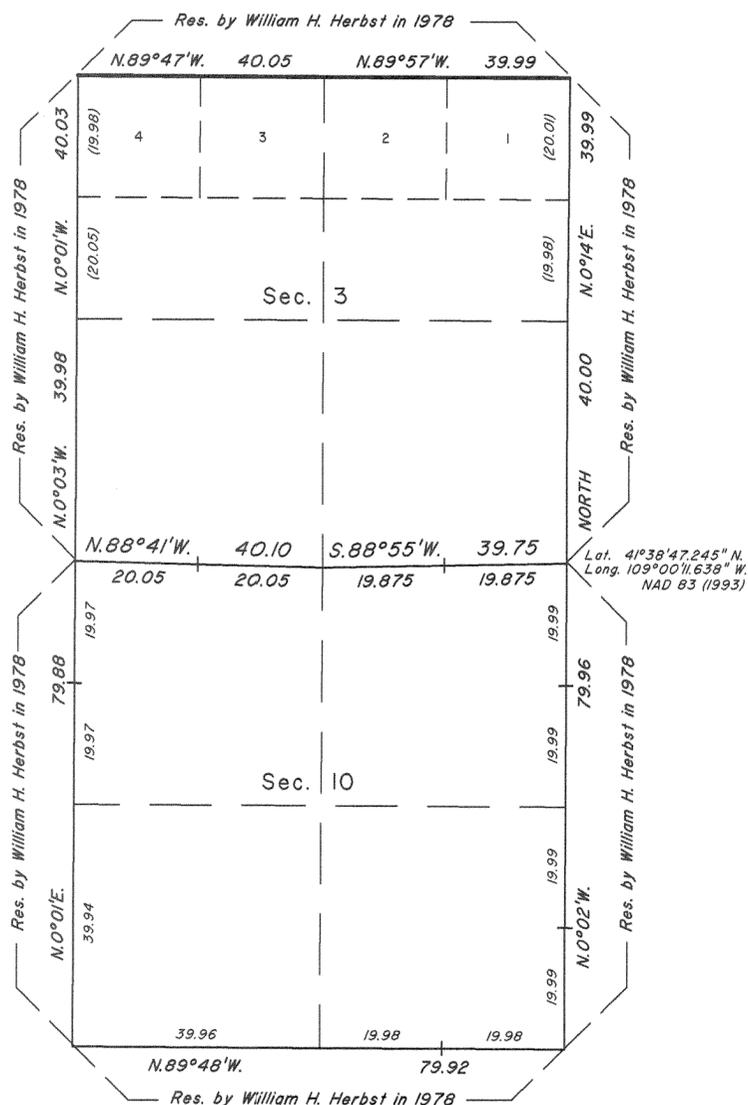

SURVEY INFORMATION AND CERTIFICATE

These plats represents the entire record of the corrective dependent resurvey of a portion of the subdivisional lines designed to restore the corners in their true original locations according to the best available evidence, Township 19 North, Range 103 West, Sixth Principal Meridian, Wyoming.

Richard Blackstone surveyed the north, east and south boundaries in 1876 and the subdivisional lines in 1877. George M.P. Dougall and Newill J. Burnham resurveyed the exterior boundaries and subdivisional lines in 1906. William H. Herbst resurveyed the exterior boundaries and subdivisional lines in 1978.

In a letter to the Chief Cadastral Surveyor, Wyoming, dated March 4, 2004, Craig A. Shauers, Wyoming Registered Land Surveyor No. 2929, detailed evidence that led him to believe that the 1978 dependent resurvey had overlooked collateral evidence and improperly restored the 1/4 section cor. of secs. 3 and 10. A subsequent field investigation confirmed Shauers' findings. The field investigation is documented in a memorandum to the Chief Cadastral Surveyor, Wyoming, dated October 26, 2004. This memorandum is included in the official file for Group 739, Wyoming. The corrective dependent resurvey shown hereon corrects the 1978 dependent resurvey.

Lotting and areas are as shown on the plat approved January 14, 1908 and the supplemental plat accepted August 21, 1956.

The survey was executed with Trimble Navigation Model 4700 Global Positioning System (GPS) receivers. The GPS procedures used were in accordance with IM No. 2001-186, "Standards and Guidelines for Cadastral Surveys Using Global Positioning System Methods", dated July 26, 2001. The directions of all lines refer to the true meridian. The directions, distances, and geographic positions were determined by GPS observations.

I, Olian T. Shockley, HEREBY CERTIFY upon honor, that in pursuance of special instructions bearing the date of October 20, 2004, and Assignment Instructions dated October 20, 2004, for Group Number 739, Wyoming, I have corrected the dependent resurvey of a portion of the subdivisional lines, Township 19 North, Range 103 West, Sixth Principal Meridian, Wyoming, and that these plats represents the entire record of this survey. Survey commenced November 1, 2004, and completed April 20, 2005, and has been made in strict conformity with the special instructions, the Manual of Surveying Instructions for the Survey of Public Lands of the United States, 1973, and the manner described hereon.

Olian T. Shockley
Olian T. Shockley
Cadastral Surveyor

June 2, 2005
Date


UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Cheyenne, Wyoming June 2, 2005

This plat representing the entire record of this survey, having been correctly executed in accordance with the requirements of law and the regulations of this bureau, is hereby accepted.

For the Director

John P. Lee
John P. Lee
Chief Cadastral Surveyor for Wyoming

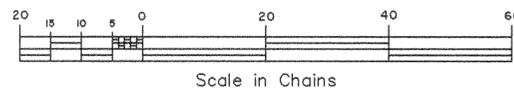

TOWNSHIP 19 NORTH, RANGE 103 WEST, OF THE SIXTH PRINCIPAL MERIDIAN, WYOMING.

CORRECTIVE DEPENDENT RESURVEY

The cor. of secs. 2, 3, 10 and 11, monumented with an iron post, 2½ ins. diam., firmly set, witnessed by an iron rod, 1 in diam., projecting 24 ins. above ground alongside the cor., with a steel fence post nearby, with brass cap mkd.

T19N R103W
S 3 | S 2
S 10 | S 11
1978

Cor. is located on open barren ground.

Point for the E 1/16 sec. cor. of secs. 3 and 10.

Set a Berntsen Feno® monument, a chrome plated steel rod, ⅝ in. diam., 24 ins. long, 23 ins. in the ground, with aluminum cap mkd.

BLM
T19N R103W
S 3
E 1/16
S 10
2004
CADASTRAL SURVEY

Set a steel fence post nearby.

Cor. is located in an abandoned asphalt roadway, 4 lks. S. of a line of abandoned cars, bears E. and W.

Note: No evidence remains of the erroneous position of the E 1/16 sec. cor. of secs. 3 and 10, monumented during the 1978 dependent resurvey. This position falls in a track road in the Wyoming Auto Junkies, Inc. automobile salvage yard.

The 1/4 sec. cor. of secs. 3 and 10, determined at a burned and fragmented fence cor. (wooden), indeterminate diam., 14 ins. below the surface of the ground. Abandoned fence posts extend N. and E., an abandoned 4 strand barbed wire fence extends S. This is accepted as the best available evidence of the position of the original cor.

At the corner point

Set a stainless steel post, 28 ins. long, 2½ ins. diam., 25 ins. in the ground, over a plastic coated magnet, with brass cap mkd.

T19N R103W
S 3
1/4
S 10
2004

Raise a mound of stone, 2 ft. base, 1 ft. high, N.; and set a steel fence post nearby.

From this point, the erroneous position of the 1/4 sec. cor. of secs. 3 and 10, reestablished during the 1978 dependent resurvey, bears N. 11° 52' W., 85.3 lks. dist.; monumented with an iron post, 2½ ins. diam., 28 ins. long, firmly set, flush with the surface of the ground, with brass cap mkd. T19N R103W S3 1/4 S10 1978. Add the mks. AM 2004 on the brass cap and bury the iron post in place 7 ins. below the surface of the ground, over a plastic coated magnet, and set a steel fence post nearby.

From this same point, the original 1/4 sec. cor. of secs. 3 and 10, a sandstone, 18x11x3 ins., lying disturbed atop the ground, plainly mkd. 1/4 on one face, bears S. 19° 26' W., 31.6 lks. dist. Remove this stone from the vicinity.

Point for the W 1/16 sec. cor. of secs. 3 and 10.

Set a stainless steel post, 28 ins. long, 2½ ins. diam., 21 ins. in the ground, over a plastic coated magnet, with brass cap mkd.

T19N R103W
S 3
W 1/16
S 10
2004

Set a steel fence post nearby.

Cor. is located 4 lks. N. of the southern right-of-way fence of U.S. Interstate Highway I-80, bears ENE. and WSW.

From this point, a broken cement post, 5 ins. square, firmly set, projecting 5 ins. above ground, bears N. 3° 07' E., 42.3 lks. dist. No brass tablet was found.

From this same point, the erroneous position of the W 1/16 sec. cor. of secs. 3 and 10, established during the 1978 dependent resurvey, bears N. 12° 47' W., 42.4 lks. dist.; monumented with a bent iron post, 2½ ins. diam., 28 ins. long, firmly set, projecting 6 ins. above ground, with brass cap. Add the mks. AM on the iron post, cut in half and then bury in place, 6 ins. below the surface of the ground, over a plastic coated magnet and set a steel fence post nearby.

From this same point, a brass tablet, set in the top of a cement post, 6 ins. square, firmly set, projecting 4 ins. above ground, mkd. STATE HIGHWAY DEPT. SEC LINE 1500+80 sta EI 6372.53 -R.O.W. MARKER-, bears S. 61° 16' W., 22.86 chs. dist.

The cor. of secs. 3, 4, 9 and 10, monumented with an iron post, 2½ ins., firmly set, with a steel fence post nearby, with brass cap mkd.

T19N R103W
S 4 | S 3
S 9 | S 10
1978

Cor. is located on open barren ground.

The coordinates are listed for location purposes only; not for determination of the position of the corner.

(Coordinates are NAD 83 1993)

Corner: cor. of secs. 2, 3, 10 and 11
Latitude: 41° 38' 47.245" N.
Longitude: 109° 00' 11.638" W.

Corner: E 1/16 sec. cor. of secs. 3 and 10
Latitude: 41° 38' 47.001" N.
Longitude: 109° 00' 28.909" W.

Corner: 1/4 sec. cor. of secs. 3 and 10
Latitude: 41° 38' 46.756" N.
Longitude: 109° 00' 46.180" W.

Corner: W 1/16 sec. cor. of secs. 3 and 10
Latitude: 41° 38' 47.058" N.
Longitude: 109° 01' 03.601" W.

Corner: cor. of secs. 3, 4, 9 and 10
Latitude: 41° 38' 47.360" N.
Longitude: 109° 01' 21.023" W.

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Cheyenne, Wyoming

June 2, 2005

This plat representing the entire record of this survey, having been correctly executed in accordance with the requirements of law and the regulations of this bureau, is hereby accepted.

For the Director

John P. Lee

John P. Lee
Chief Cadastral Surveyor for Wyoming