

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FIELD NOTES

OF THE

REMONUMENTATION

OF THE

STANDARD 1/4 SECTION CORNER OF SECTION 36,

THE

1/4 SECTION CORNER OF SECTIONS 31 AND 36, T. 13 N., RS. 83 AND 84 W.,

AND THE

1/4 SECTION CORNER OF SECTIONS 25 AND 36,

TOWNSHIP 13 NORTH, RANGE 84 WEST,

OF THE SIXTH PRINCIPAL MERIDIAN,

IN THE STATE OF WYOMING.

EXECUTED BY

CARL W. SUMPTER

SUPERVISORY
CADASTRAL SURVEYOR
(USFS)

LESLIE J. GROSS

FOREST LAND SURVEYOR
(USFS)

Under Special Instructions dated JUNE 27, 1996, approved JULY 1, 1996, which provided for the surveys included under Group Number 624, Wyoming, and Assignment Instructions dated JULY 1, 1996, and APRIL 19, 1999.

Remonumentation commenced JULY 8, 1996

Remonumentation completed AUGUST 5, 2011

INDEX DIAGRAM

Township 13 North, Range 84 West

6	5	4	3	2	1
7	8	9	10	11	12
18	17	16	15	14	13
19	20	21	22	23	24
30	29	28	27	26	25
					3
31	32	33	34	35	36
					1

T. 13 N., R. 84 W., Sixth Principal Meridian, Wyoming

Chains

The following field notes are those of the remonumentation of the standard 1/4 section corner of section 36, the 1/4 section corner of sections 31 and 36, T. 13 N., Rs. 83 and 84 W., and the 1/4 sec. cor. of secs. 25 and 36, Township 13 North, Range 84 W, Sixth Principal Meridian, Wyoming.

The history of surveys pertaining to this remonumentation is as follows:

William O. Downey surveyed the Third Standard Parallel North, through Range 84 West (south boundary), and the east boundary in 1879. Howard B. Carpenter retraced that portion of the Third Standard Parallel North, through Range 84 West, along the south boundary of section 36, (subsequently changing the record), retraced the east boundary, and surveyed the subdivisional lines in 1897. Thomas W. Crawford remonumented certain corners in 1960.

The records of the 1997-98 remonumentation field work were destroyed in 1999. In 2011, the field work of 1997-98 was validated and deemed correct.

Preliminary to the remonumentation, a diligent search was made for all corners and other calls of the field note record. Identified corners were remonumented in their original positions.

Remonumentation of the Standard 1/4 Section Corner of Section 36,
T. 13 N., R. 84 W., Sixth Principal Meridian, Wyoming

The standard 1/4 sec. cor. of sec. 36, identical to the 1/4 sec. cor. of section 1 only, T. 12 N., R. 84 W., monumented with a granite stone, 16x14x5 ins., firmly set 11 ins. in the ground, plainly mkd. SC 1/4 on N. face.

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 20 ins. in the ground, in a collar of stone, with aluminum cap mkd.

T13N R84W
S 36
1/4——
S 1
T12N
1998

Remonumentation of the Standard 1/4 Section Corner of Section 36,
T. 13 N., R. 84 W., Sixth Principal Meridian, Wyoming

Chains

Bury the mkd. stone alongside and set a fiberglass sign post N. of the aluminum post.

from which new bearing trees

A pine, 17 ins. diam., bears N. 6° E., 17 lks. dist., mkd. T13N
R84W 1/4 S 36 BT.

A pine, 10 ins. diam., bears SOUTH., 9 lks. dist., mkd. T12N
R84W 1/4 S 1 BT.

Cor. is located in stand of mixed pine timber.

Remonumentation of the 1/4 Section Corner of Sections 31 and 36,
T. 13 N., Rs. 83 and 84 W., Sixth Principal Meridian, Wyoming

The 1/4 sec. cor. of secs. 31 and 36, monumented with a granite stone, 15x12x6 ins., firmly set 10 ins. in the ground, plainly mkd. 1/4 on W. face, in a mound of stone.

At the corner point

Set an aluminum post, 28 ins. long, 2½ ins. diam., 24 ins. in the ground, in a collar of stone, with aluminum cap mkd.

T13N
R84W R83W
1/4
S 36 | S 31
1997

Buried the mkd. stone alongside and set an aluminum “U” shaped sign post with USFS land survey monument sign attached N. of the aluminum post.

from which new bearing trees

A pine, 7 ins. diam., bears N. 24° W., 18 lks. dist., mkd. 1/4 S
36 BT.

A pine, 8 ins. diam., bears S. 13° E., 10 lks. dist., mkd. 1/4 S
31 BT.

Remonumentation of the 1/4 Section Corner of Sections 31 and 36,
T. 13 N., Rs. 83 and 84 W., Sixth Principal Meridian, Wyoming

<p>Chains</p>	<p>Cor. is located in dense stand of mixed pine timber.</p> <hr/> <p style="text-align: center;">Remonumentation of the 1/4 Section Corner of Sections 25 and 36, T. 13 N., R. 84 W., Sixth Principal Meridian, Wyoming</p> <hr/> <p>The 1/4 sec. cor. of secs. 25 and 36, monumented with a granite stone, 12x12x4 ins., firmly set 8 ins. in the ground, plainly mkd. 1/4 on N. face.</p> <p>At the corner point</p> <p>Set an aluminum post, 28 ins. long, 2½ ins. diam., 25 ins. in the ground, in a collar of stone, with aluminum cap mkd.</p> <div style="text-align: center;"> <p>T13N R84W S 25 1/4—— S 36 1997</p> </div> <p>Buried the mkd. stone alongside and set an aluminum “U” shaped sign post with USFS land survey monument sign attached NW. of the aluminum post.</p> <p>from which the original bearing trees</p> <p style="padding-left: 40px;">A pine, 16 ins. diam., bears N. 31° E., 10 lks. dist., plainly mkd. 1/4 S BT on partially healed blaze. (record: N. 33° E.)</p> <p style="padding-left: 40px;">A pine, 11 ins. diam., bears S. 8° W., 10 lks. dist., plainly mkd. 1/4 S BT on partially healed blaze. (record: S. 6° W.)</p> <p>Cor. is located on rocky W. facing slope in dense stand of pine and fir timber.</p> <hr/>
----------------------	--

T. 13 N., R. 84 W., Sixth Principal Meridian, Wyoming.

Chains	<p style="text-align: center;">GENERAL DESCRIPTION</p> <p>The area embraced by this remonumentation is situated in Carbon County, approximately 15 miles southeast of Riverside, Wyoming. The terrain is mountainous with dense stands of lodge pole pine mixed with aspen, spruce, and fir timber with undergrowth consisting of willows and native grasses. Soil is rocky. The area has an average elevation of 9,500 feet above sea level. Drainage flows southwest into Dudley Creek, and westerly into the Encampment River. The area is uninhabited with limited access by a few closed timber haul roads, with primary access from FDR No. 496 to the east.</p> <p>In early 2000, the area suffered an epidemic destruction of timber stands from Mountain Pine Beetle, destroying 90% of the pine timber stands. At the time of the 2011 remonumentation validation, the bearing trees marked in 1997-98 were dead, and extensive logging operations were being done throughout the township and specifically in section 36.</p> <hr/>
---------------	---

**UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT**

FIELD ASSISTANTS

NAMES	CAPACITY
Thomas H. Effinger Jr.	Cadastral Surveyor (USFS)
David Kaufman	Survey Technician (USFS)
Michael S. Berry	Survey Technician (USFS)
Thomas Stockslager	Cadastral Surveyor (USFS)
Jerry A. Nelson	Survey Technician (USFS)

CERTIFICATE OF SURVEY

We, Carl W. Sumpter, Supervisory Cadastral Surveyor (USFS), and Leslie J. Gross, Forest Land Surveyor (USFS), HEREBY CERTIFY upon honor that, in pursuance of special instructions bearing date of the 27th day of June, 1996, we have remonumented the standard 1/4 section corner of section 36, the 1/4 section corner of sections 31 and 36, T. 13 N., Rs. 83 and 84 W., and the 1/4 section corner of sections 25 and 36, Township 13 North, Range 84 W., of the Sixth Principal Meridian, Wyoming, which are represented in the foregoing field notes as having been executed by us and under our direction. Said survey has been made in strict conformity with said special instructions, the Manual of Instructions for the Survey of the Public Lands of the United States, and in specific manner described in the foregoing field notes.

May 31, 2013

(Unavailable for Signature)

Date

Carl W. Sumpter
Supervisory Cadastral Surveyor (USFS)

May 31, 2013

(Unavailable for Signature)

Date

Leslie J. Gross
Forest Land Surveyor (USFS)


CERTIFICATE OF APPROVAL

BUREAU OF LAND MANAGEMENT
Cheyenne, Wyoming

The foregoing field notes of the remonumentation of the standard 1/4 section corner of section 36, T. 13 N., R. 84 W., the 1/4 section corner of sections 31 and 36, T. 13 N., Rs. 83 and 84 W., and the 1/4 section corner of sections 25 and 36, Township 13 North, Range 84 W., of the Sixth Principal Meridian, Wyoming, executed by Carl W. Sumpter, Supervisory Cadastral Surveyor (USFS), having been critically examined and found correct, are hereby approved.

May 31, 2013

Date

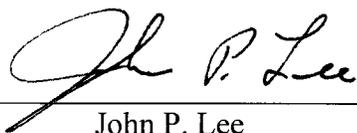

John P. Lee
Chief Cadastral Surveyor for Wyoming